

To: NVE
Attn.: Odd-Arne Jensen
Copy to:
Date: 2021-03-22
Revision no./Rev.date: 0 /
Document no.: 20200017-05-TN
Project: AARN - Applied Avalanche Research in Norway
Project manager: Christian Jaedicke
Prepared by: Peter Gauer, Henrik Langeland
Reviewed by: Henrik Langeland

WP 2 – Full-scale experiments at Ryggfonn Ryggfonn avalanche observations 2019/2020

Contents

1	Introduction	2
2	Research goals	2
3	Methods	2
4	Results	4
	4.1 Weather data at the Fonnbu station	5
	4.2 Observations at Ryggfonn	6
5	Concluding remarks	18
6	References	18

Review and reference page

1 Introduction

NGI is operating the avalanche test site at Ryggfonn in Stryn municipality, Vestland county, western Norway (61.969°N, 7.275°E) since early 1980s.

In addition to the field work and data collection in frame work of WP2, necessary repairs and updating of the data acquisition system at the Ryggfonn avalanche test site were carried out under this task. This is to ensure that the site is ready for the winter season 2020/2021.

2 Research goals

A main challenge for avalanche research is to obtain a comprehensive understanding of the different flow regimes (dense, fluidized, or suspension flow) and of the involved physical processes. To obtain the necessary understanding, a combination of different measurements and observations is desirable to gain a broad and consistent picture of the avalanche flow. The understanding of complexity and variety of avalanche motion requires a combination of small-scale experiments (detailed investigations, statistics), large-scale tests (detailed investigation), and field observations (diversity, statistics). Cross-comparison between different avalanche paths (test sites) is necessary to uncover scaling relations, i.e. to identify differences in avalanche behavior arising from variations in total length or slope along avalanche paths.

Field observations and full-scale tests under controlled conditions are still necessary for the mentioned reasons and as a basis for statistical analysis.

3 Methods

NGI's operating the avalanche test site at Ryggfonn near Stryn since early 1980s (Gauer et .et. al. 2010; Gauer & Kristensen, 2016, and refences therein). The facilities at Ryggfonn consist of the main and secondary avalanche tracks with a vertical drop of 950 m, a catchment dam at the base, and several instrumentation installations for monitoring avalanche dynamics. The current facility is one of only two in the world of this scale, and the catchment dam is a unique feature making this location the only place in the world where the efficiency of avalanche mitigation can be studied in full-scale.

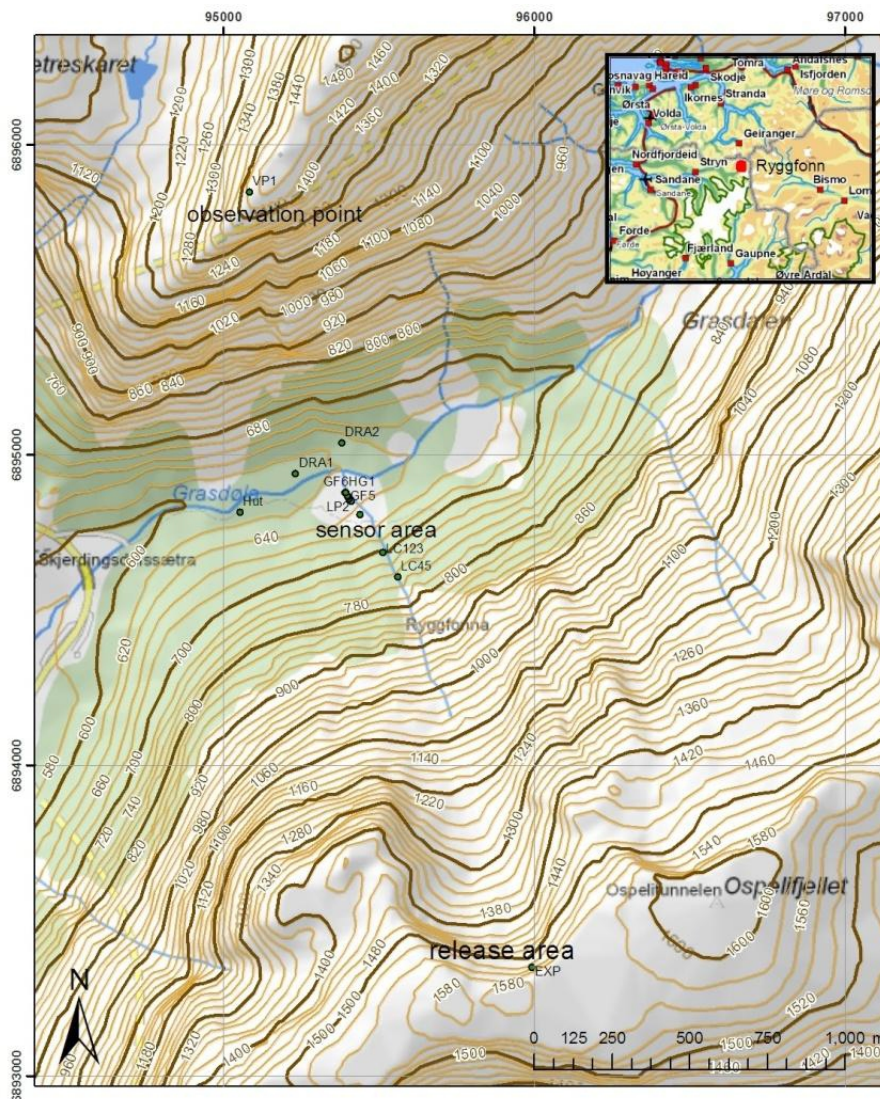


Figure 1 Map of the Ryggfonn test-site.

The NGI Ryggfonn facility was developed to obtain measurements to characterise avalanche dynamics and benchmark the development and calibration of numerical models. The full-scale testing facility was needed to investigate the complex dependency of avalanches on ambient conditions which cannot be reproduced in small-scale experiments. Data collected include velocity measures; impact pressure measurements, and flow height measurements at selected locations along the avalanche track. Field investigations are performed to collect runout data and data on mass balance. Corresponding meteorological data are measured at a close-by NGI station, Fonnbu.

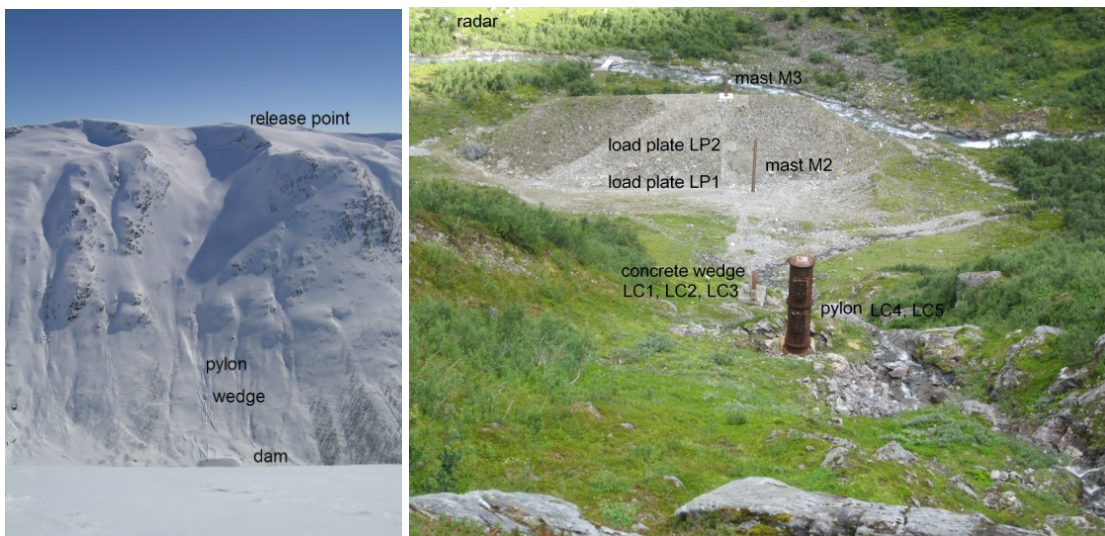


Figure 2 Existing NGI facility at Ryggfonn: (left) Avalanche track from the release area down to the retaining dam; (right) Example of sensor installations and full-scale pylon in the lower part of the avalanche track.

4 Results

Ten natural avalanches of size 2 to 3 (on the EAWS avalanche size scale) occurred during the winter 2019/2020. The avalanches released during end of December and beginning of January, in February, one in March and two early April. Due to Covid-19 restrictions, it was not possible to launch a field campaign in 2020. Nonetheless, the natural releases provided some pressure data and rough estimates on local velocities. Those events, however, showed again that it is desirable to have an autonomous RADAR system at the site to obtain velocity data and a system of time lapse cameras to obtain continuous information about the conditions before and after natural releases. Although field observations were carried out on few occasions after an event, the gained information were limited by weather constraints.

In this section a brief overview of the collected raw data is shown.

4.1 Weather data at the Fonnbu station

Figure 3 display an overview of major meteorological parameters throughout the season 2019/2020, with markers each month.

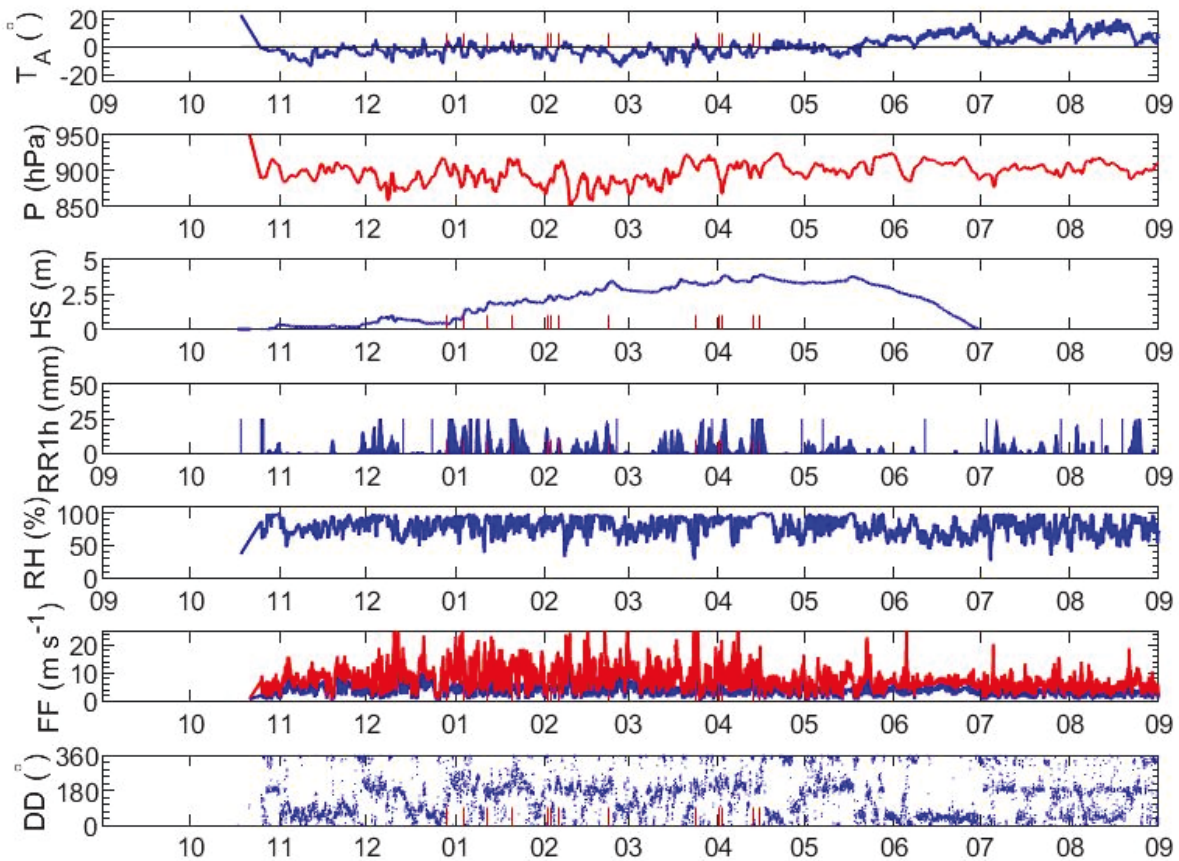


Figure 3 Overview of the major meteorological parameters (hourly data) during the season 2019/2020. The red stems in some of the plots indicate the date of the know avalanche event at Ryggfonn.

4.2 Observations at Ryggfonn

Table 1 Overview of natural avalanche release during 2019/2020; U_{LC} is the averaged velocity between the pylon and the concrete wedge.

Date (yyyymmdd)	time	U_{LC} (m/s)
20191229	NaN	NaN
20200104	00:50	16.2
20200111	21:09	NaN
20200120	12:00	5.3
20200202	07:23	NaN
20200203	06:49	NaN
20200205	16:11	17.0
20200223	01:26	46.0
20200324	13:53	31.0
20200401	14:40	NaN
20200402	10:01	28.0
20200413	14:28	16.2
20200415	16:55	NaN

Velocity estimates

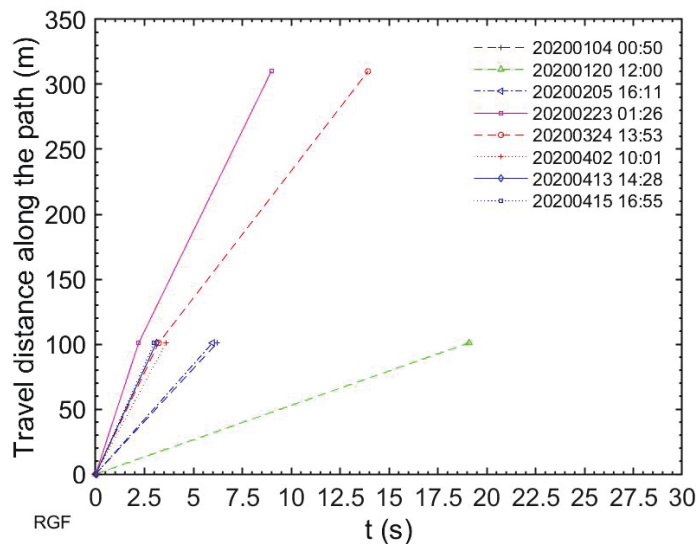


Figure 4 Timing of the avalanche. $T=0$ at the pylon, T_1 at concrete wedge, and T_2 at Mast #2(LC45, and LC123in Figure 1 and Figure 2).

Deposition area

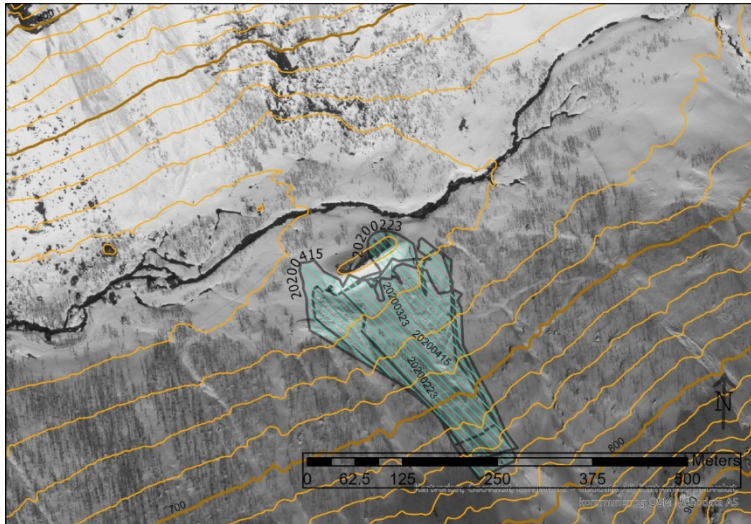


Figure 5 Deposition area of three natural avalanche events in 2020 based on brief field surveys; dates of the events are indicated.

2020-12-29T12:29

No useful data available

2020-01-04T00:50

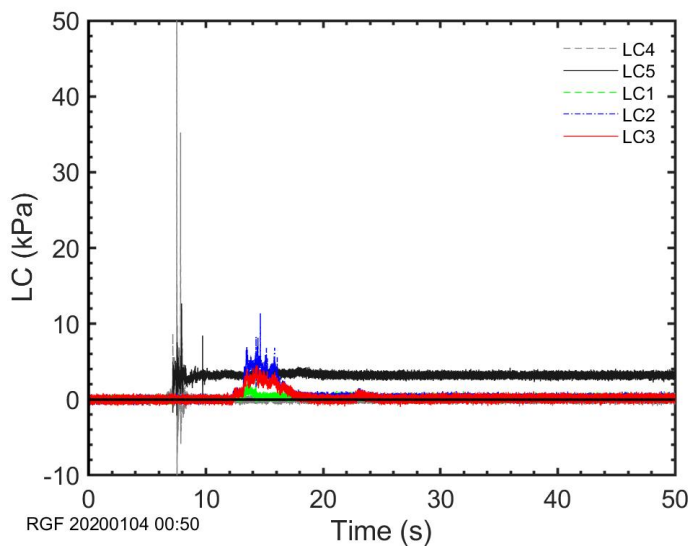


Figure 6 Load cell measurement: pressure vs. time at the position of the tower (LC45) and the concrete wedge (LC123).

2020-01-11T21:09

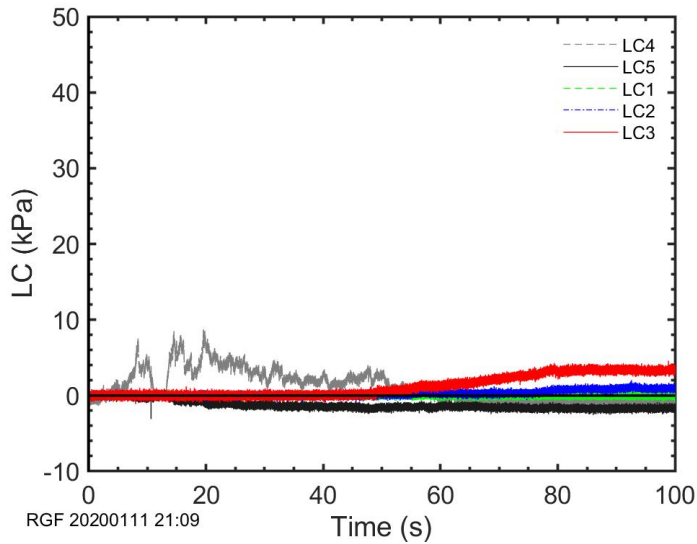


Figure 7 Load cell measurement: pressure vs. time at the position of the tower (LC45) and the concrete wedge (LC123).

2020-01-20T12:00

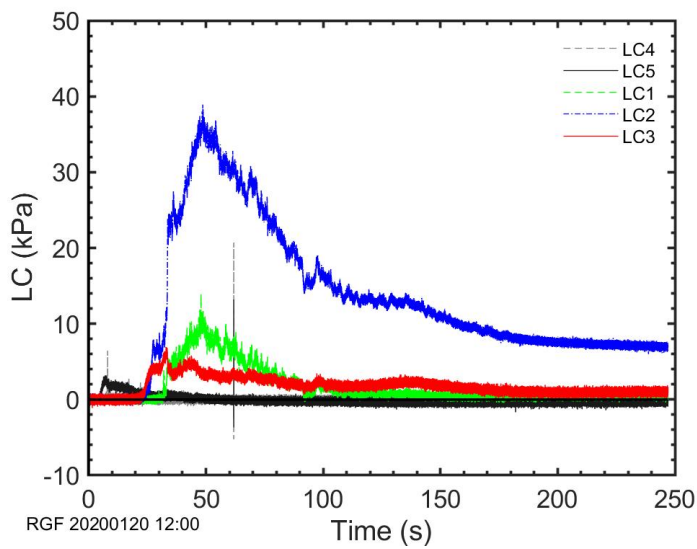


Figure 8 Load cell measurement: pressure vs. time at the position of the tower (LC45) and the concrete wedge (LC123).

2020-02-02T07:23

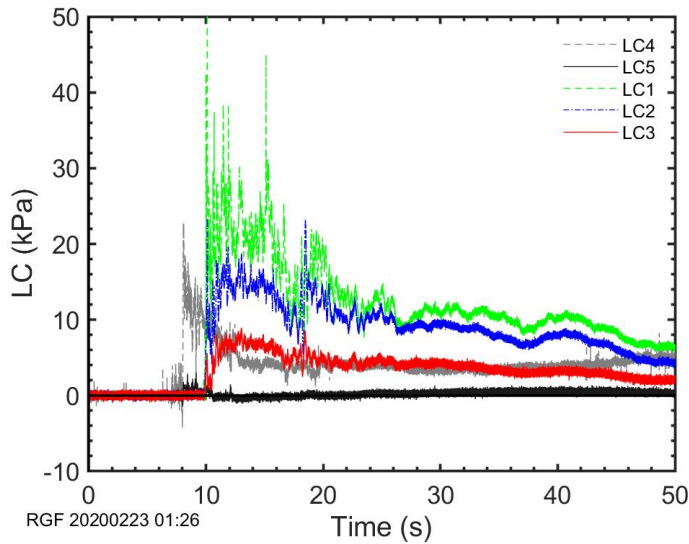


Figure 9 Load cell measurement: pressure vs. time at the position of the tower (LC45) and the concrete wedge (LC123).

2020-02-03T06:49

No useful data available

2020-02-05T16:10

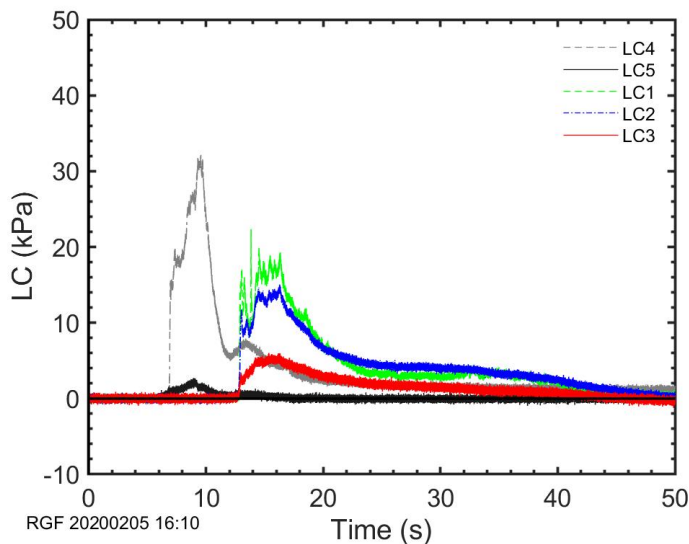


Figure 10 Load cell measurement: pressure vs. time at the position of the tower (LC45) and the concrete wedge (LC123).

2020-02-23T01:26

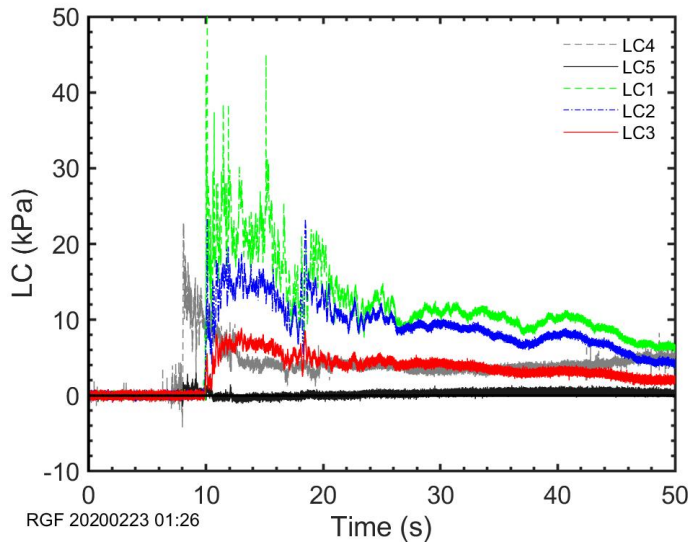


Figure 11 Load cell measurement: pressure vs. time at the position of the tower (LC45) and the concrete wedge (LC123).

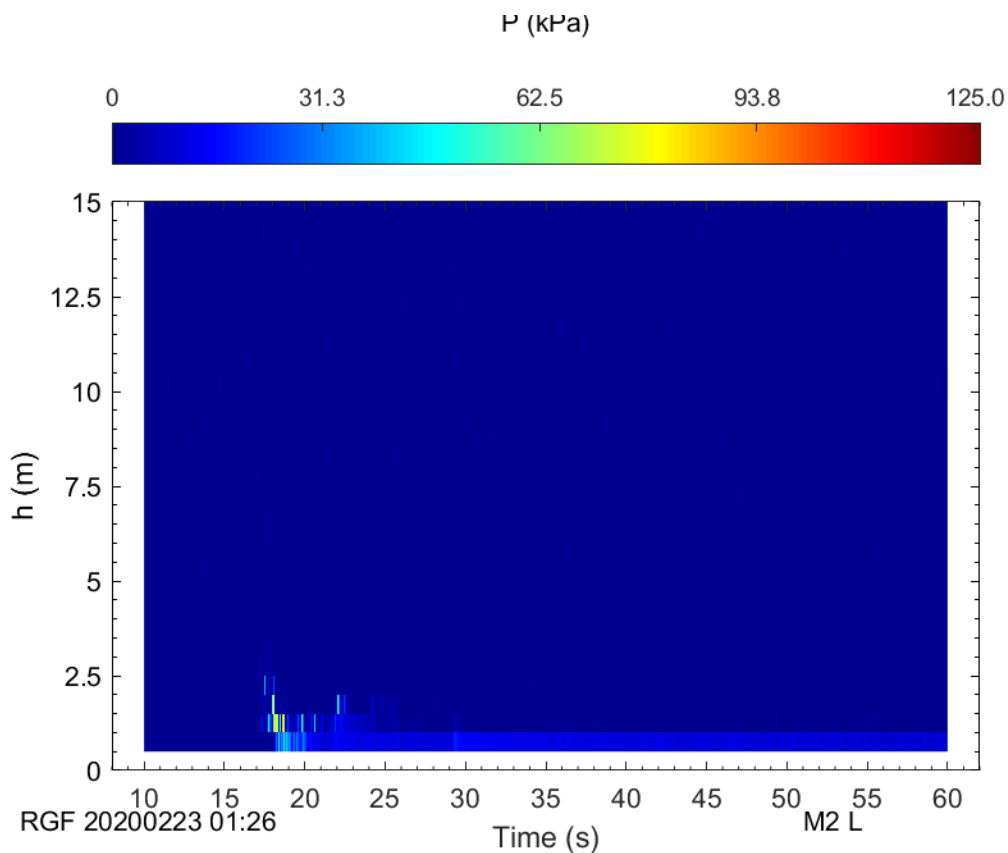


Figure 12 Load cell measurement: pressure vs. time at the position of Mast M2.

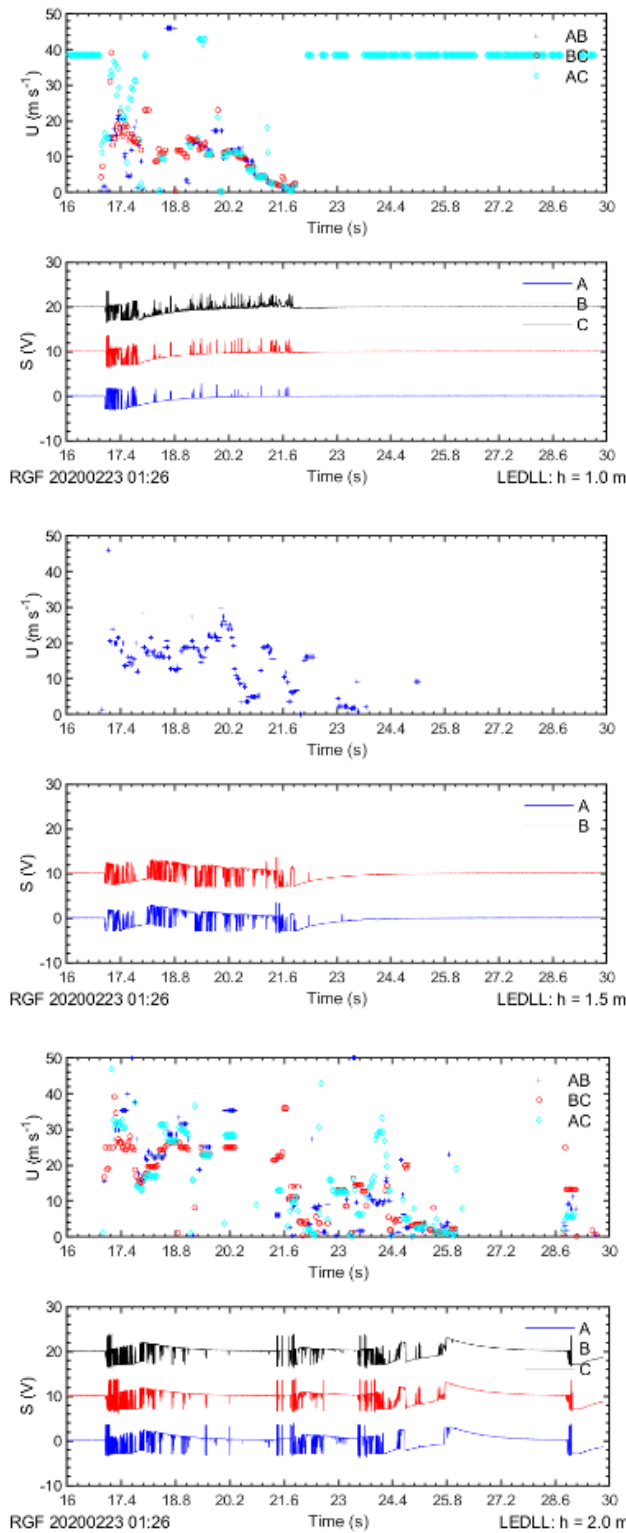


Figure 13 Preliminary velocity (U) estimates based on cross-correlated LED-data at 1.0, 1.5, and 2.0 m above ground. In addition, the raw data of the led-sensors are plotted.



Figure 14 Track of the 2020-02-23T01:16 event; photo taken on afternoon of 2020-02-26 (photos Henrik Langeland).



Figure 15 Back side of the dam after the 2020-02-23T01:16 event (photo Henrik Langeland 2020-02-26).

2020-03-24T13:53

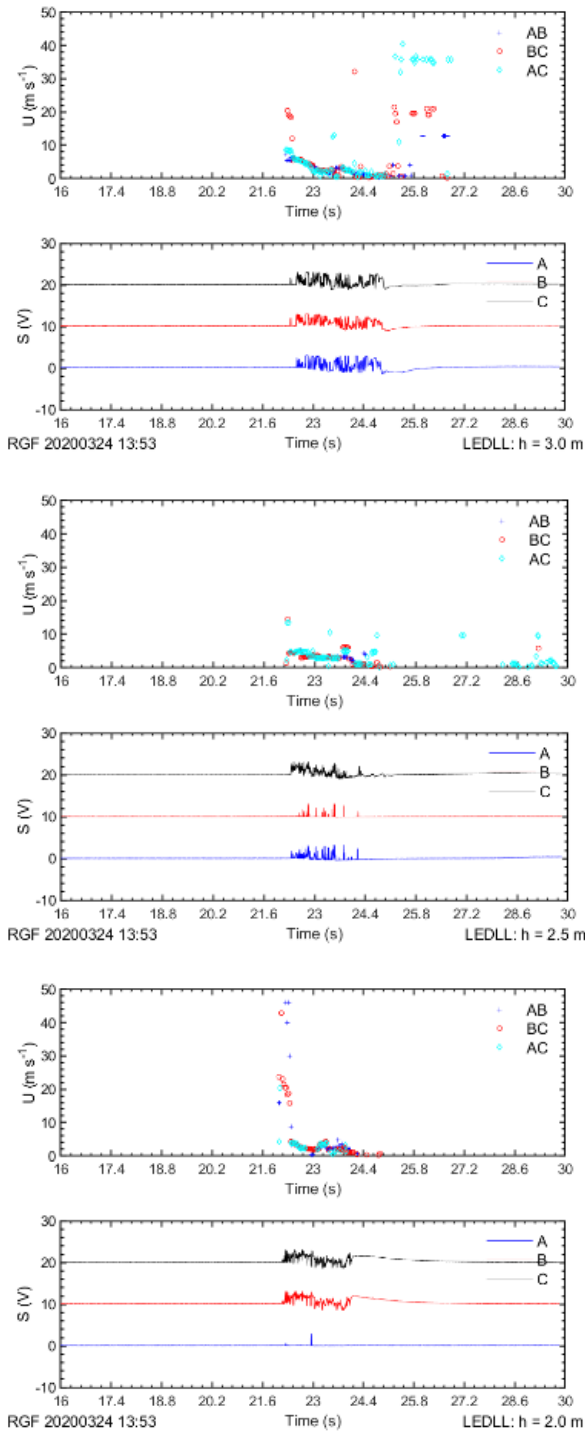


Figure 16 Preliminary velocity (U) estimates based on cross-correlated LED-data at 2.0, 2.5, and 3.0 m above ground. In addition, the raw data of the led-sensors are plotted.



Figure 17 Deposition area of the 2020-03-24T13:53 event; photo taken on afternoon of 2020-03-26 (photos Henrik Langeland).

2020-04-01T14:40

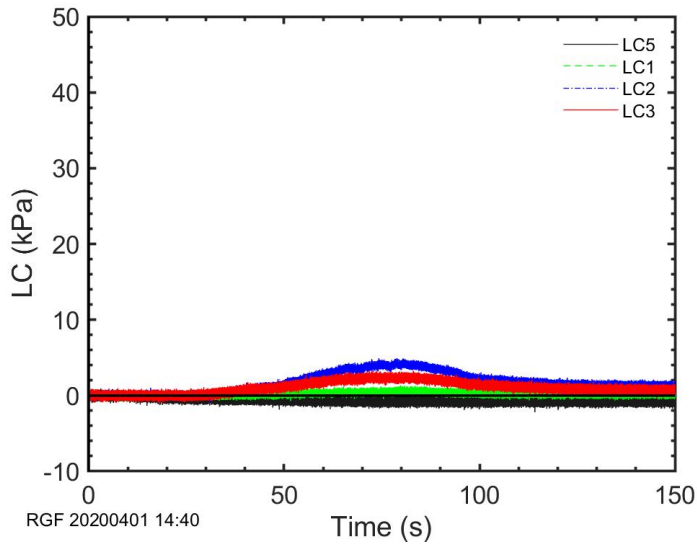


Figure 18 Load cell measurement: pressure vs. time at the position of the tower (LC45) and the concrete wedge (LC123).

2020-04-02T10:01

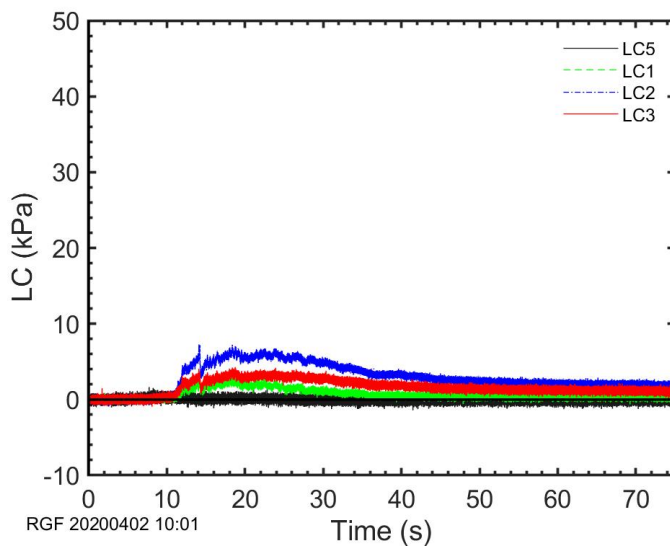


Figure 19 Load cell measurement: pressure vs. time at the position of the tower (LC45) and the concrete wedge (LC123).

2020-04-13T14:28

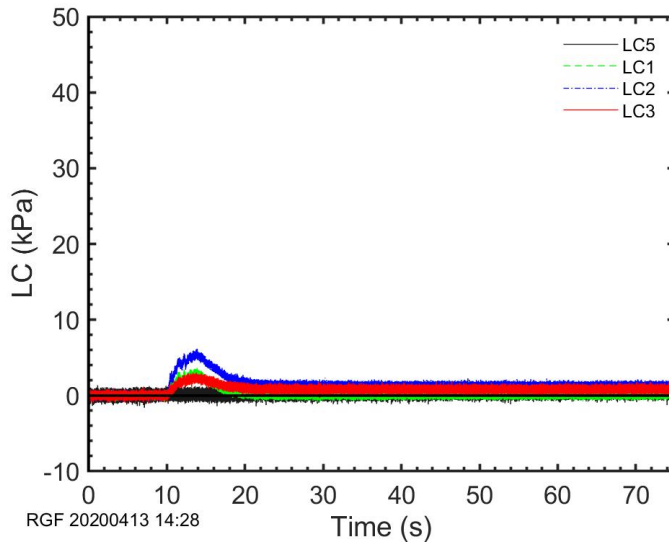


Figure 20 Load cell measurement: pressure vs. time at the position of the tower (LC45) and the concrete wedge (LC123).

2020-04-15T16:55

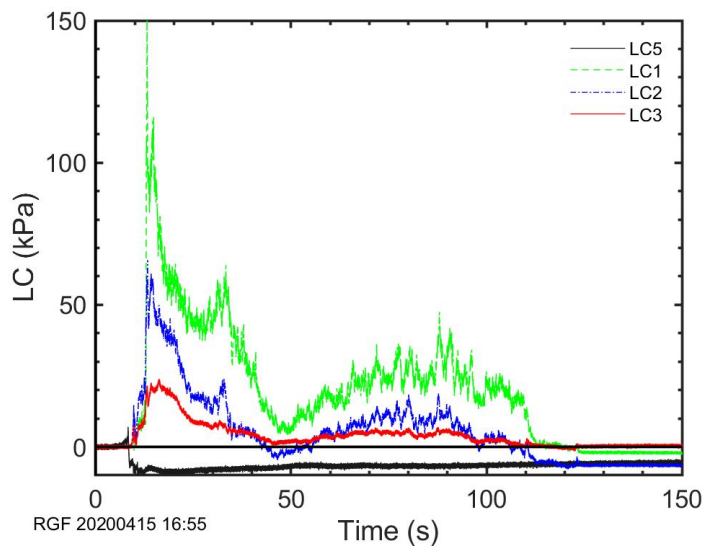


Figure 21 Load cell measurement: pressure vs. time at the position of the tower (LC45) and the concrete wedge (LC123).



Figure 22 Deposition area of the 2020-04-15T16:55 event; photo taken on morning of 2020-04-18 (photos Henrik Langeland).

5 Concluding remarks

With financial means through GBV funds several upgrades at the Ryggfonn test site could be established or prepared this season. The updates include two small weather station at the top and at the valley bottom to have better information on the environmental conditions pre- and during avalanche release. This also includes a laser scanner for the release area. Secondly, the infrastructure for the installation of an autonomous pulsed Doppler radar was put in place. The radar is expected to be installed early 2021 in cooperation with BFW in Innsbruck, Austria, which offered a Doppler-RADAR systems for Ryggfonn.

6 References

- Gauer, P.; Breien, H.; Issler, D.; Kristensen, K.; Kronholm, K.; Lied, E. & Lied, K. (2010) The upgraded full-scale avalanche test-site Ryggfonn, Norway, Proceedings of the International Snow Science Workshop, Lake Tahoe, CA, October 17-22, 2010, 2010, 747-752
- Gauer, P. & Kristensen, K. (2016) Four decades of observations from NGI's full-scale avalanche test site Ryggfonn---Summary of experimental results, Cold Regions Science and Technology, 2016 , 125 , 162-176
- Norem, H.; Kvisterøy, T. K. & Evensen, B. D. (1985), Measurements of avalanche speeds and forces: Instrumentation and preliminary results of the Ryggfonn project Annals of Glaciology, 1985, 6, 19-22

Dokumentinformasjon/Document information		
Dokumenttittel/Document title WP 2 – Full-scale experiments at Ryggfonn. Ryggfonn avalanche observations 2019/2020		Dokumentnr./Document no. 20200017-05-TN
Dokumenttype/Type of document Teknisk notat / Technical note	Oppdragsgiver/Client NVE	Dato/Date 2021-03-22
Rettigheter til dokumentet iht kontrakt/ Proprietary rights to the document according to contract Oppdragsgiver / Client		Rev.nr.&dato/Rev.no.&date 0 /
Distribusjon/Distribution ÅPEN: Skal tilgjengeligjøres i åpent arkiv (BRAGE) / OPEN: To be published in open archives (BRAGE)		
Emneord/Keywords Norwegian_avalanche_grant		

Stedfesting/Geographical information	
Land, fylke/Country Norway	Havområde/Offshore area
Kommune/Municipality Stryn	Feltnavn/Field name
Sted/Location Grasdalen	Sted/Location
Kartblad/Map	Felt, blokknr./Field, Block No.
UTM-koordinater/UTM-coordinates Zone: East: North:	Koordinater/Coordinates Projection, datum: East: North:

Dokumentkontroll/Document control					
Kvalitetssikring i henhold til/Quality assurance according to NS-EN ISO9001					
Rev/ Rev.	Revisjonsgrunnlag/Reason for revision	Egenkontroll av/ Self review by:	Sidemanns- kontroll av/ Colleague review by:	Uavhengig kontroll av/ Independent review by:	Tverrfaglig kontroll av/ Interdisciplinary review by:
0	Original document	2021-03-19 Peter Gauer	2021-03-19 Henrik Langeland		

Dokument godkjent for utsendelse/ Document approved for release	Dato/Date 22 March 2021	Prosjektleder/Project Manager Christian Jaedicke
--	-----------------------------------	--

NGI (Norwegian Geotechnical Institute) is a leading international centre for research and consulting within the geosciences. NGI develops optimum solutions for society and offers expertise on the behaviour of soil, rock and snow and their interaction with the natural and built environment.

NGI works within the following sectors: Offshore energy – Building, Construction and Transportation – Natural Hazards – Environmental Engineering.

NGI is a private foundation with office and laboratories in Oslo, a branch office in Trondheim and daughter companies in Houston, Texas, USA and in Perth, Western Australia

www.ngi.no

NGI (Norges Geotekniske Institutt) er et internasjonalt ledende senter for forskning og rådgivning innen ingeniørrelaterte geofag. Vi tilbyr ekspertise om jord, berg og snø og deres påvirkning på miljøet, konstruksjoner og anlegg, og hvordan jord og berg kan benyttes som byggegrunn og byggemateriale.

Vi arbeider i følgende markeder: Offshore energi – Bygg, anlegg og samferdsel – Naturfare – Miljøteknologi.

NGI er en privat næringsdrivende stiftelse med kontor og laboratorier i Oslo, avdelingskontor i Trondheim og datterselskaper i Houston, Texas, USA og i Perth, Western Australia.

www.ngi.no

Neither the confidentiality nor the integrity of this document can be guaranteed following electronic transmission. The addressee should consider this risk and take full responsibility for use of this document.

This document shall not be used in parts, or for other purposes than the document was prepared for. The document shall not be copied, in parts or in whole, or be given to a third party without the owner's consent. No changes to the document shall be made without consent from NGI.

Ved elektronisk overføring kan ikke konfidensialiteten eller autentisiteten av dette dokumentet garanteres. Adressaten bør vurdere denne risikoen og ta fullt ansvar for bruk av dette dokumentet.

Dokumentet skal ikke benyttes i utdrag eller til andre formål enn det dokumentet omhandler. Dokumentet må ikke reproduseres eller leveres til tredjemann uten eiers samtykke. Dokumentet må ikke endres uten samtykke fra NGI.

